

**VICTOR REINZ®**



**SUBARU**  
**Q2 / 2024**



**[VictorReinz.com/online-catalog](https://VictorReinz.com/online-catalog)**

# Victor Reinz®

at a Glance



## Online Catalog

[VictorReinz.com/online-catalog](https://VictorReinz.com/online-catalog)



## Newsletter

[VictorReinz.com/EN/News/Newsletter.aspx?region](https://VictorReinz.com/EN/News/Newsletter.aspx?region)



## Youtube

[www.youtube.com/user/VictorReinzSealingEN](https://www.youtube.com/user/VictorReinzSealingEN)



## Catalog News

[VictorReinz.com/news](https://VictorReinz.com/news)



## Technical Service Information

[VictorReinz.com/tsi](https://VictorReinz.com/tsi)



## Facebook

[www.facebook.com/VictorReinzParts](https://www.facebook.com/VictorReinzParts)



## Just seal it!

[VictorReinz.com/jsi](https://VictorReinz.com/jsi)



## Technical Datasheet

[VictorReinz.com/jsi-datasheet](https://VictorReinz.com/jsi-datasheet)



## LinkedIn

[www.linkedin.com/showcase/victor-reinz-emea](https://www.linkedin.com/showcase/victor-reinz-emea)



## Safety Datasheet

[VictorReinz.com/jsi-datasheet](https://VictorReinz.com/jsi-datasheet)



## Homepage

[VictorReinz.com](https://VictorReinz.com)





[VictorReinz.com/catalog-info](https://VictorReinz.com/catalog-info)



[VictorReinz.com/catalog-how-to-use](https://VictorReinz.com/catalog-how-to-use)



# SUBARU



**0-9**

1KR-FE	6
1KR-VET	6
1ND-TV	8
1NR-FE	7
1NR-FKE	8
1NZ-FE	10

**E**

EA65	6
EA71	10
EA82	14
EE20	15
EE20Z	15-17
EF10	5
EF12	6
EJ16	10
EJ161	11
EJ16E	11
EJ18	14
EJ18 SPI	14
EJ18E	14
EJ20	17
EJ20 EMPI	17
EJ201	19
EJ202	19
EJ204	20-22
EJ205	23-24
EJ207	24-25
EJ208	25
EJ20E	18
EJ20G	18
EJ20J	18
EJ22 EMPI	31
EJ25	32-35
EJ251	36
EJ253	36-37
EJ255	38-40
EJ257	40-41
EJ25D	35
EK23	5
EK42	5
EL15	9
EL154	9
EZ30	44



EZ36D 45

**F**

FA20	26
FA20D	27
FA20E	26
FA20F	26
FA24C	32
FA24D	32
FB16	12
FB16A	12-13
FB16B	13
FB20	27
FB20A	28
FB20B	27-28
FB20C	29
FB20D	29
FB20W	30
FB20X	31
FB25	42-43
FB25A	44
FB25B	44
FB25C	43
FB25D	43



**K**

K3-VE	7
-------	---

**M**

M13A	7
M15A	9

SUBARU

Ltr.  0,5 EK23 23 kW (31 PS) REX 08/77-06/87  1



01-52525-01

49712-3051



02-52525-01

49712-3051 HS



61-52525-00

41230-5700



78 Ø



12-53043-01

41277-5400 (2x)

+41279-1300 (2x)



0,7 EK42 27 kW (37 PS) REX 08/82-06/89

01-52525-01

49712-3051



02-52525-01

49712-3051 HS



61-52525-00

41230-5700

78 Ø



12-53043-01

41277-5400 (2x)

+41279-1300 (2x)



1,0 EF10 37 kW (50 PS) JUSTY 05/87-10/95

01-52530-02

49712-3058

02-52530-02

49712-3058 HS



61-52530-00


41230-6202

79,5 Ø



71-52526-00

13294-KA061



12-53043-02

41277-5400 (3x)

+41279-1300 (3x)



71-52527-00 


14038-KA050



71-52524-00

41160-5500



81-53227-00 

30x46

A SL RD MVQ



81-53266-00 

38,5x53

A SL RD



1,0 EF10 37-40 kW (50-54 PS) JUSTY LIBERO 01/83-12/90

01-52530-01


49712-3057

 ⇒ 06/85

01-52530-02

49712-3058


 07/85→



02-52530-01

49712-3057 HS

 ⇒ 06/85

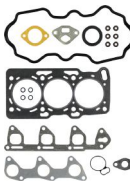

02-52530-02

49712-3058 HS

 07/85→



61-52530-00

41230-6202


79,5 Ø



71-52523-00

41260-5600

 ⇒ 06/85



71-52526-00

13294-KA061

 07/85→



12-53043-02

41277-5400 (3x)

+41279-1300 (3x)



71-52527-00 

14038-KA050


 07/85→



71-52524-00

41160-5500




81-53227-00 

30x46

A SL RD MVQ




81-53266-00 





















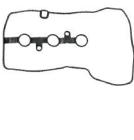
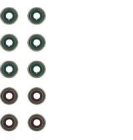
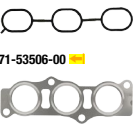


38,5x53

A SL RD


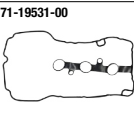
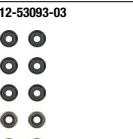




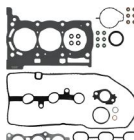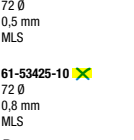









SUBARU




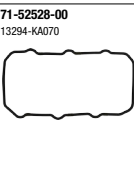
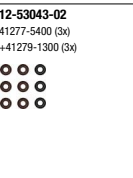

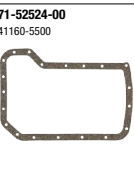





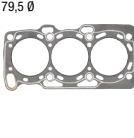
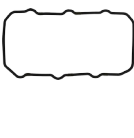
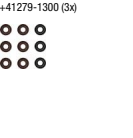

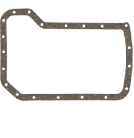

Ltr.  1,0 1KR-FE 51 kW (69 PS) JUSTY 01/07

										
01-53425-01	02-53425-01			61-53425-00 72 Ø 0,5 mm MLS  61-53425-10  72 Ø 0,8 mm MLS	14-32366-01	71-53503-00	12-53507-01	71-53504-00   71-53506-00 	70-31414-10	81-34146-00  38x50 A SL RD FPM  81-53509-00  74x89 A SL LD MVQ
										


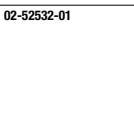

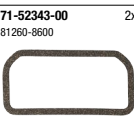
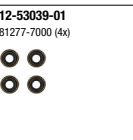
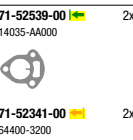









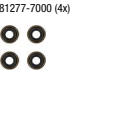



1,0 1KR-VET 72 kW (98 PS) JUSTY 11/16





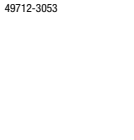









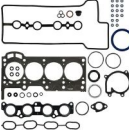
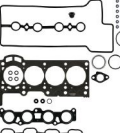






























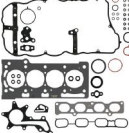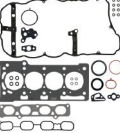


										
					14-32366-01	71-19531-00	12-53093-03  70-53093-00  6x  70-54062-00  6x	71-19284-00 	70-31414-10	81-53508-00  38x50 A SL RD FPM/ACM  81-53509-00  74x89 A SL LD MVQ
										

1,2 EF12 38-50 kW (52-68 PS) JUSTY LIBERO 06/86-02/00



										
01-52535-02 49712-3013	02-52535-02 49712-3013 HS			61-52535-00 11044-KA030 79,5 Ø		71-52528-00 13294-KA070	12-53043-02 41277-5400 (3x) +41279-1300 (3x)	71-52527-00 14038-KA050	71-52524-00 41160-5500	81-53227-00  30x46 A SL RD MVQ  81-53266-00  38,5x53 A SL RD
										


















































1,3 EA65 45-48 kW (61-65 PS) LEONE 03/79-09/91

										
01-52532-01 49712-3053	02-52532-01			61-52532-00 2x 11044-KA410 86,8 Ø		71-52343-00 2x 81260-8600	12-53039-01 81277-7000 (4x)	71-52539-00  2x 14035-AA000  71-52341-00  2x 64400-3200	71-52342-00 81160-6100	81-53263-00  80673-8040 38x55 A SL RD NBR
										

SUBARU															
Ltr.															
1,3	K3-VE	67-68 kW (91-92 PS)	DEX JUSTY	03/07									 		 
1,3	M13A	69 kW (94 PS)	JUSTY	09/03							 	 	 		 
1,3	1NR-FE	70-73 kW (95-99 PS)	TREZIA	11/10								  	 		 


SUBARU

Ltr.  1,3 1NR-FKE 73 kW (99 PS) TREZIA  03/11

                                                
--





SUBARU




Ltr. 

1,5 EL15  
EL154

74-85 kW (101-116 PS)

 IMPREZA

 06/01




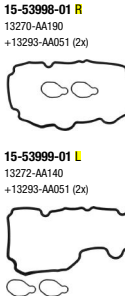
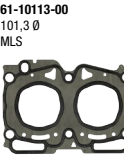
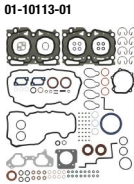


1,5 M15A

73 kW (99 PS)





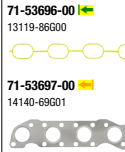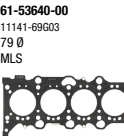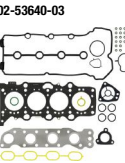






















JUSTY

09/03








SUBARU














Ltr.  1,5 1NZ-FE 76-80 kW (103-109 PS) TREZIA  03/11

										
01-53135-04	02-53135-05			61-53135-10 75,5 Ø 0,5 mm MLS	14-55033-01	71-17260-00	12-54024-01 90913-02101 (8x) +90913-02112 (8x)	71-19189-00  71-53089-00  71-17261-00 	70-31414-10 	81-53218-00  90311-25032 25,5x37,5 A SL RD NBR
							 8x  8x			 81-53313-00  75x107 A SL LD MVQ

1,6 EA71 52-63 kW (71-86 PS) LEONE MV 06/78-12/94



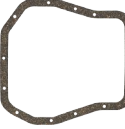
























01-52537-01 49712-3000	02-52537-01 49712-3000 HS			61-52537-00 41230-7122 94 Ø		71-52343-00 81260-8600	12-53039-01 81277-7000 (4x)	71-52539-00  14035-AA000	71-52342-00 81160-6100	
								71-52341-00  64400-3200		

1,6 EJ16 66-70 kW (90-95 PS) IMPREZA LEGACY 05/89-09/06






















01-52990-01 10105-AA130	02-52990-01			61-52990-00 11044-AA120 89 Ø	2x	71-52951-00 13294-AA010	12-52829-01	71-52942-00  14035-AA290	71-52946-00	81-53333-00  80678-6040 86x103 A SL LD MVQ
								71-52943-00  71-52944-00  71-52938-10 		 81-53239-00  80673-2150 32x45 A SL RD ACM

SUBARU

Ltr.  1,6 EJ16E 66 kW (90 PS) IMPREZA  01/93-12/00 












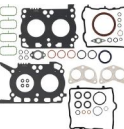
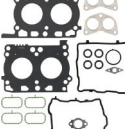



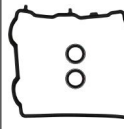
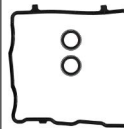














										
				<b>61-52990-00</b> 2x 11044-AA120 89 Ø 	<b>14-11006-01</b> 11095-AA123 (8x) +11095-AA141 (4x) 	<b>71-52951-00</b> 2x 13294-AA010 	<b>12-53919-01</b> 13207-AA050 (8x) +13211-AA050 (8x)  <b>70-53989-00 ES</b> 8x 13207-AA120  <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-52942-00</b>  2x 14035-AA290  <b>71-52938-10</b>  2x 44616-AA291 		<b>81-53918-00</b>  80673-3030 33x49 A SL RD FPM  <b>81-53333-00</b>  80678-6040 86x103 A SL LD MVQ  <b>81-53239-00</b>  2x 80673-2150 32x45 A SL RD ACM 

1,6 EJ161 66-88 kW (90-120 PS) IMPREZA 01/93-06/09






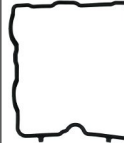














<b>01-10254-01</b> 10105AA280	<b>02-10254-01</b>    			<b>61-10254-00</b> 2x 11044AA573 89,5 Ø 0,5 mm MLS 	<b>14-11006-01</b> 11095-AA123 (8x) +11095-AA141 (4x) 	<b>71-53988-00</b> 2x 13294-AA053 	<b>12-53989-01</b> 13207-AA120 (8x) +13211-AA110 (8x)  <b>70-53989-00 ES</b> 8x 13207-AA120  <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-53992-00</b>  2x 14035-AA383  <b>71-52938-10</b>  2x 44616-AA291 	<b>70-31414-10</b> 	<b>81-53918-00</b>  80673-3030 33x49 A SL RD FPM  <b>81-53333-00</b>  80678-6040 86x103 A SL LD MVQ  <b>81-53239-00</b>  2x 80673-2150 32x45 A SL RD ACM 
----------------------------------	--	--	--	---	--	---	---	--	---	--

SUBARU

Ltr.  1,6 FB16 125 kW (170 PS) LEVORG 09/15

										
<b>01-11325-01</b> 10105-AB770 	<b>02-11325-01</b> 			<b>61-11325-00 R</b> 11044-AA880 81,8 Ø 0,6 mm MLS  <b>61-11326-00 L</b> 10944-AA170 81,8 Ø 0,6 mm MLS 	<b>14-11012-01</b> 11095-AA042 (6X) 	2x <b>15-10675-01 R</b> 13270-AA250 +10966-AA040 (2X)  <b>15-20003-01 L</b> 13272-AA270 +10966-AA040 (2X) 	<b>12-10695-01</b> 13207-AA110 (8x) +13211-AA100 (8x)  <b>70-10695-00 AS</b> 13211-AA100 8x  <b>70-11562-00 ES</b> 13207-AA110 8x 	<b>71-20004-00</b>  4x 14035-AA700  <b>71-16042-00</b>  ① 14035-AA570  <b>71-52938-10</b>  2x 44616-AA291 	<b>70-31414-10</b> 	<b>81-53387-00</b>   80675-0070 50x62 RD  <b>81-10384-00</b>   80679-2010 92x109 A SL LD FPM 

1,6 FB16A 84 kW (114 PS) IMPREZA XV 03/12

<b>01-10257-01</b> 10105-AB490 	<b>02-10257-01</b> 			<b>61-10257-00 L</b> 10944-AA090 79,8 Ø 0,5 mm MLS  <b>61-10258-00 R</b> 11044-AA800 79,8 Ø 0,5 mm MLS 	<b>14-11012-01</b> 11095-AA042 (6X) 	2x <b>71-10693-00 R</b> 13270-AA240  <b>71-10694-00 L</b> 13272-AA170 	<b>12-10695-01</b> 13207-AA110 (8x) +13211-AA100 (8x)  <b>70-10695-00 AS</b> 13211-AA100 8x  <b>70-11562-00 ES</b> 13207-AA110 8x 	<b>71-10697-00</b>  2x 14035-AA580  <b>71-52938-10</b>  2x 44616-AA291 	<b>70-31414-10</b> 	<b>81-53387-00</b>   80675-0070 50x62 RD  <b>81-10384-00</b>   80679-2010 92x109 A SL LD FPM 
--	---	--	--	---	---	---	--	---	---	--



## SUBARU


Ltr.  1,6 FB16A 84-85 kW (114-116 PS) IMPREZA XV 10/16



01-11325-01  
10105-AB770



02-11325-01

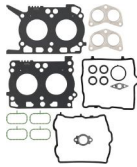

61-11325-00 R  
11044-AA880  
81,8 Ø  
0,6 mm  
MLS



61-11326-00 L  
10944-AA170  
81,8 Ø  
0,6 mm  
MLS




14-11012-01  
11095-AA042 (6X)




2x




15-10675-01 R  
13270-AA250  
+10966-AA040 (2X)

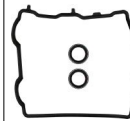

15-20003-01 L  
13272-AA270  
+10966-AA040 (2X)

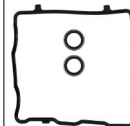


12-10695-01  
13207-AA110 (8x)  
+13211-AA100 (8x)

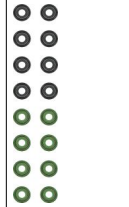

70-10695-00 AS 8x  
13211-AA100



70-11562-00 ES 8x  
13207-AA110



71-20004-00 L 4x  
14035-AA700



71-52938-10 44616-AA291



70-31414-10



81-53387-00 K 80675-0070  
50x62  
RD




81-10384-00 K 80679-2010  
92x109  
A SL LD FPM



1,6 FB16B 84-85 kW (114-115 PS) IMPREZA XV 03/12



01-10257-01  
10105-AB490




02-10257-01



61-10257-00 L  
10944-AA090  
79,8 Ø  
0,5 mm  
MLS




61-10258-00 R  
11044-AA800  
79,8 Ø  
0,5 mm  
MLS




14-11012-01  
11095-AA042 (6X)





2x




71-10693-00 R  
13270-AA240

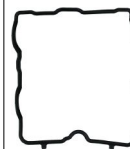

71-10694-00 L  
13272-AA170

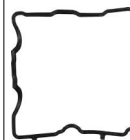

12-10695-01  
13207-AA110 (8x)  
+13211-AA100 (8x)

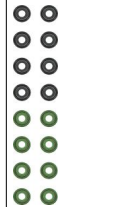

70-10695-00 AS 8x  
13211-AA100



70-11562-00 ES 8x  
13207-AA110



71-10697-00 L 2x  
14035-AA580



71-16042-00 L 14035-AA570



71-52938-10 44616-AA291



70-31414-10




81-53387-00 K 80675-0070  
50x62  
RD







81-10384-00 K 80679-2010  
92x109  
A SL LD FPM







SUBARU




Ltr.  1,8 EA82 66-72 kW (90-98 PS) LEONE 11/84-09/94

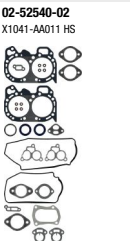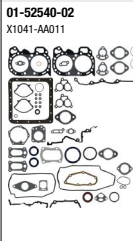


1,8 EA82 66-77 kW (90-105 PS) LEONE 06/85-07/87

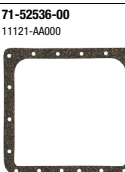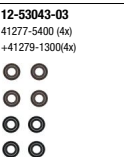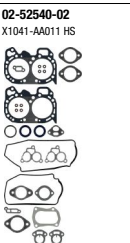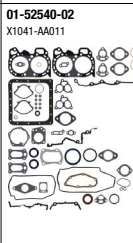


1,8 EJ18 EJ18 SPI EJ18E 76-82 kW (103-112 PS) IMPREZA LEGACY 01/89-12/00

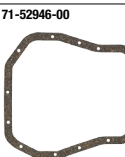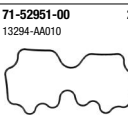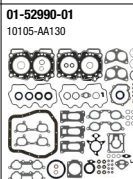

SUBARU

Ltr.  2,0 EE20 EE20Z 80-110 kW (109-150 PS) FORESTER D IMPREZA IMPREZA D LEGACY D OUTBACK D XV D 01/09

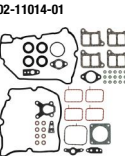

**61-10781-00 R**  
11044-AA740  
86,5 Ø  
0,95 mm  
MLS



**61-10781-10 R**  
11044-AA730  
86,5 Ø  
1 mm  
MLS



**61-10781-20 R**  
11044-AA750  
86,5 Ø  
1,05 mm  
MLS




**61-10782-00 L**  
10944-AA040  
86,5 Ø  
0,95 mm  
MLS



**61-10782-10 L**  
10944-AA030  
86,5 Ø  
1 mm  
MLS



**61-10782-20 L**  
10944-AA050  
86,5 Ø  
1,05 mm  
MLS

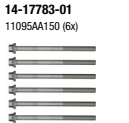


2x

**15-17784-01 R**  
13270AA220  
+13294AA080 (2x)




**15-17785-01 L**  
13272AA160  
+13294AA080 (2x)

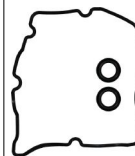

**71-17784-00 R**  
13270AA220



**71-17785-00 L**  
13272AA160

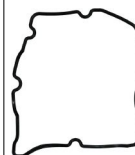

**12-17789-01**  
13211-AA120 (8x)



**70-17789-00**  
13211-AA120



2x

**71-17791-00 L**  
14035-AA550



**71-17792-00**  
44616AA080



4x
















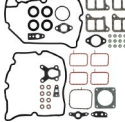



































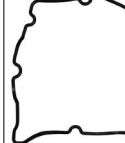
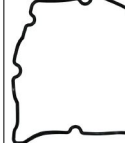
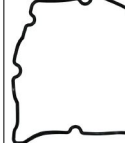
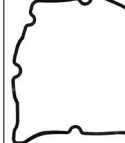
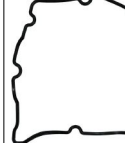
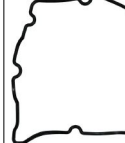
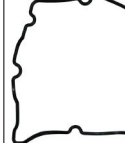
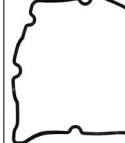
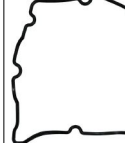
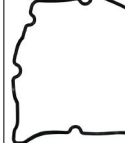
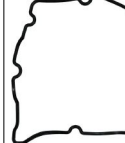
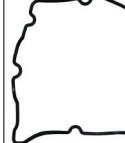
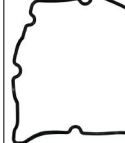
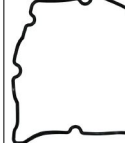
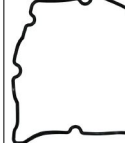
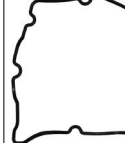
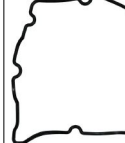
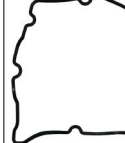
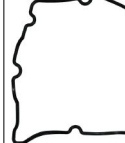
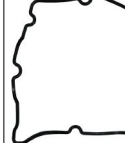
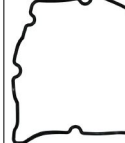
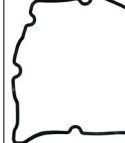
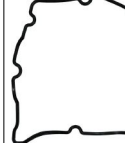
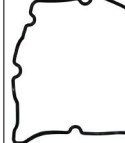
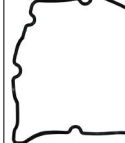
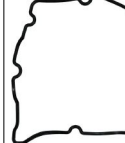
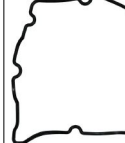
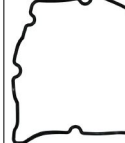
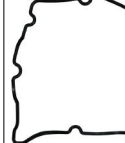
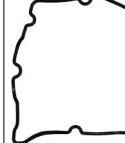
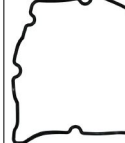
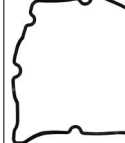
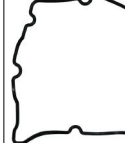
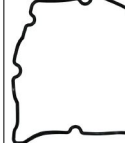
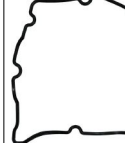
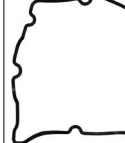
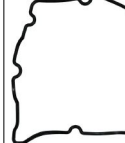
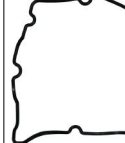
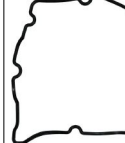
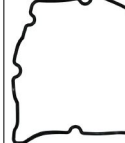
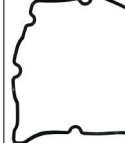
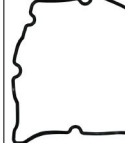
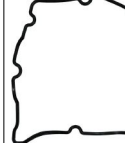
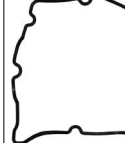
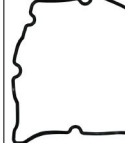
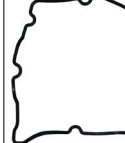
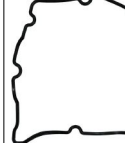
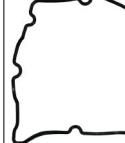
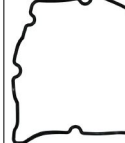
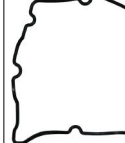
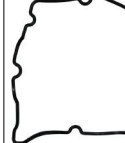
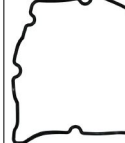
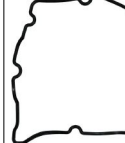
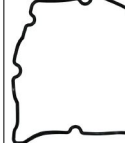
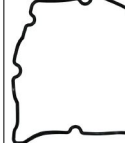
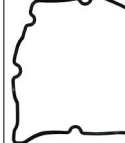
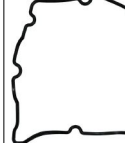
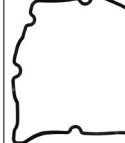
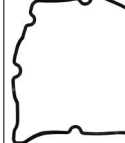
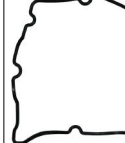
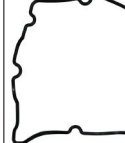
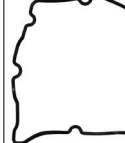
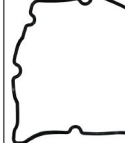


**81-10589-00 K**  
806737010  
37x52,5  
A SL RD FPM
















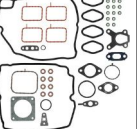













































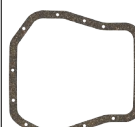

























































**81-53333-10 K**  
80678-8050  
86x103  
A SL LD FPM



SUBARU																																																																															
Ltr.																																																																															
2,0	EE20Z	108-110 kW (147-150 PS)	FORESTER D LEGACY OUTBACK D	02/08-09/13																																																																											
					<div><div>01-11014-01</div><div>10105-AB240</div><div></div></div>	<div><div>02-11014-01</div><div></div><div></div></div>																																																																									
					<div><div>61-10781-00 R</div><div>11044-AA740</div><div>86,5 Ø</div><div>0,95 mm</div><div>MLS</div><div></div></div>	<div><div>61-10781-10 R</div><div>11044-AA730</div><div>86,5 Ø</div><div>1 mm</div><div>MLS</div><div></div></div>	<div><div>61-10781-20 R</div><div>11044-AA750</div><div>86,5 Ø</div><div>1,05 mm</div><div>MLS</div><div></div></div>	<div><div>61-10782-00 L</div><div>10944-AA040</div><div>86,5 Ø</div><div>0,95 mm</div><div>MLS</div><div></div></div>	<div><div>61-10782-10 L</div><div>10944-AA030</div><div>86,5 Ø</div><div>1 mm</div><div>MLS</div><div></div></div>	<div><div>61-10782-20 L</div><div>10944-AA050</div><div>86,5 Ø</div><div>1,05 mm</div><div>MLS</div><div></div></div>	<div><div>14-17783-01</div><div>11095AA150 (6x)</div><div></div></div>	<div><div>15-17784-01 R</div><div>13270AA220</div><div>+13294AA080 (2x)</div><div></div></div>	<div><div>12-17789-01</div><div>13211-AA120 (8x)</div><div></div></div>	<div><div>71-17789-00</div><div>13211-AA120</div><div></div></div>	<div><div>71-17784-00 R</div><div>13270AA220</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17784-00 R</div><div>13270AA220</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div><div>13272AA160</div><div></div></div>	<div><div>71-17785-00 L</div></div>

































SUBARU																		
Ltr.																		
2,0	EE20Z	110 kW (150 PS)	OUTBACK D	03/15	<div><div>01-11099-01</div><div>10105-AB720</div><div></div></div>	<div><div>02-11099-01</div><div></div></div>			<div><div>61-10809-00 R</div><div>11044-AA850</div><div>86,5 Ø</div><div>0,95 mm</div><div>MLS</div><div></div></div>	<div><div>14-17783-01</div><div>11095AA150 (8x)</div><div></div></div>	2x	<div><div>15-18161-01 R</div><div>13270-AA280</div><div>+13294-AA100 (2x)</div><div></div></div>	<div><div>12-17789-01</div><div>13211-AA120 (8x)</div><div></div></div>	2x	<div><div>71-17791-00 </div><div>14035-AA550</div><div></div></div>	4x	<div><div>70-31414-10</div><div></div></div>	<div><div>81-10589-00 </div><div>806737010</div><div>37x52,5</div><div>A SL RD FPM</div><div></div></div>
								<div><div>61-10809-10 R</div><div>11044-AA840</div><div>86,5 Ø</div><div>1 mm</div><div>MLS</div><div></div></div>			<div><div>15-18164-01 </div><div>13272-AA230</div><div>+13294-AA100 (2x)</div><div></div></div>	<div><div>70-17789-00</div><div>13211-AA120</div><div></div></div>	16x	<div><div>71-17792-00 </div><div>44616AA080</div><div></div></div>	2x		<div><div>81-53333-10 </div><div>80678-6050</div><div>86x103</div><div>A SL LD FPM</div><div></div></div>	
								<div><div>61-10810-00 </div><div>10944-AA140</div><div>86,5 Ø</div><div>0,95 mm</div><div>MLS</div><div></div></div>			<div><div>71-18161-00 R</div><div>13270-AA280</div><div></div></div>							
								<div><div>61-10810-10 </div><div>10944-AA130</div><div>86,5 Ø</div><div>1 mm</div><div>MLS</div><div></div></div>			<div><div>71-18164-00 </div><div>13272-AA230</div><div></div></div>							
								<div><div>61-10810-20</div><div>10944-AA150</div><div>86,5 Ø</div><div>1,05 mm</div><div>MLS</div><div></div></div>										
2,0	EJ20 EJ20 EMPI	85-118 kW (116-160 PS)	IMPREZA LEGACY	08/91-03/11	<div><div>01-52995-01</div><div>10105-AA070</div><div></div></div>	<div><div>02-52995-01</div><div></div></div>		<div><div>61-52995-00</div><div>11044-AA364</div><div>93 Ø</div><div></div></div>	2x	<div><div>71-52951-00</div><div>13294-AA010</div><div></div></div>	2x	<div><div>12-52829-01</div><div></div></div>	<div><div>71-52942-00 </div><div>14035-AA290</div><div></div></div>	2x	<div><div>71-52938-10 </div><div>44616-AA291</div><div></div></div>	2x	<div><div>71-52946-00</div><div></div></div>	<div><div>81-53333-00 </div><div>80678-6040</div><div>86x103</div><div>A SL LD MVQ</div><div></div></div>
													<div><div>81-53239-00 </div><div>80673-2150</div><div>32x45</div><div>A SL RD ACM</div><div></div></div>					


















SUBARU																
Ltr.																
2,0	EJ20E	85-103 kW (115-140 PS)	IMPREZA LEGACY	06/91-12/00	<b>01-52995-01</b> 10105-AA070 	<b>02-52995-01</b> 			<b>61-52995-00</b> 2x 11044-AA364 93 Ø 	<b>14-11006-01</b> 11095-AA123 (8x) +11095-AA141 (4x) 	<b>71-52951-00</b> 2x 13294-AA010 	<b>12-52829-01</b> 	<b>71-52942-00</b>  2x 14035-AA290 	<b>71-52946-00</b> 2x 	<b>81-53333-00</b>  80678-6040 86x103 A SL LD MVQ 	
2,0	EJ20G	155-184 kW (211-250 PS)	IMPREZA	10/93-12/00						<b>14-11012-01</b> 2x 11095-AA042 (6x) 		<b>12-53989-01</b> 13207-AA120 (8x) +13211-AA110 (8x) 	<b>71-53921-00</b>  2x 14035-AA281 	<b>71-54001-00</b> 2x 14038-AA000 	<b>70-31414-10</b> 	<b>81-53918-00</b>  80673-3030 33x49 A SL RD FPM 
											<b>70-53989-00</b>  8x 13207-AA120 		<b>71-53921-00</b>  2x 14038-AA000 		<b>81-53333-00</b>  80678-6040 86x103 A SL LD MVQ 	
											<b>70-53991-00</b>  8x 13211-AA110 				<b>81-53239-00</b>  4x 80673-2150 32x45 A SL RD ACM 	
2,0	EJ20J	92 kW (125 PS)			<b>01-52995-02</b> 10105-AA190 	<b>02-52995-02</b> 			<b>61-52995-00</b> 2x 11044-AA364 93 Ø 		<b>71-52951-00</b> 2x 13294-AA010 	<b>12-53919-01</b> 13207-AA050 (8x) +13211-AA050 (8x) 	<b>71-53914-00</b>  4x 14035-AA350 	<b>70-31414-10</b> 	<b>81-53918-00</b>  80673-3030 33x49 A SL RD FPM 	
											<b>71-53916-00</b>  2x 	<b>71-53917-00</b>  2x 	<b>71-52938-10</b> 2x 44616-AA291 		<b>81-53333-00</b>  80678-6040 86x103 A SL LD MVQ 	
															<b>81-53239-00</b>  2x 80673-2150 32x45 A SL RD ACM 	

SUBARU

Ltr.  2,0 EJ201 85-92 kW (115-125 PS) FORESTER IMPREZA LEGACY OUTBACK  1 09/94-06/09

										
<b>01-53940-02</b> 10105-AA290	<b>02-53940-02</b> 			<b>61-53940-00</b> 2x 11044-AA483 93,7 Ø MLS 	<b>14-11006-01</b> 11095-AA123 (8x) +11095-AA141 (4x) 	<b>71-53988-00</b> 2x 13294-AA053 	<b>12-53989-01</b> 13207-AA120 (8x) +13211-AA110 (8x)  <b>70-53989-00 ES</b> 8x 13207-AA120  <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-53992-00</b>  2x 14035-AA383  <b>71-52938-10</b>  2x 44616-AA291 		<b>81-53918-00</b>  80673-3030 33x49 A SL RD FPM  <b>81-53333-00</b>  80678-6040 86x103 A SL LD MVQ  <b>81-53239-00</b>  2x 80673-2150 32x45 A SL RD ACM  <b>81-53239-00</b>  2x 80673-2150 32x45 A SL RD ACM 

2,0 EJ202 90-101 kW (122-138 PS) FORESTER LEGACY OUTBACK 08/97-10/05




















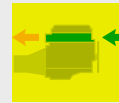






































<b>01-53940-02</b> 10105-AA290	<b>02-53940-02</b> 			<b>61-53940-00</b> 2x 11044-AA483 93,7 Ø MLS 	<b>14-11006-01</b> 11095-AA123 (8x) +11095-AA141 (4x) 	<b>71-53988-00</b> 2x 13294-AA053 	<b>12-53989-01</b> 13207-AA120 (8x) +13211-AA110 (8x)  <b>70-53991-00</b> 8x 13211-AA110 	<b>71-53992-00</b>  2x 14035-AA383  <b>71-52938-10</b>  2x 44616-AA291 	<b>70-31414-10</b> 	<b>81-53918-00</b>  80673-3030 33x49 A SL RD FPM  <b>81-53333-00</b>  80678-6040 86x103 A SL LD MVQ  <b>81-53239-00</b>  2x 80673-2150 32x45 A SL RD ACM 
-----------------------------------	--	--	--	--	--	---	--	--	---	--

Q2 / 2024





**SUBARU**

[illegible]

SUBARU															
Ltr.															
2,0	EJ204	116-118 kW (158-160 PS)	FORESTER	01/08-12/14	<b>01-11243-01</b> 10105AA990	<b>02-11243-01</b>			<b>61-11243-00</b> 2x 11044-AA680 93,7 Ø 0,6 mm MLS 	<b>14-11012-01</b> 2x 11095-AA042 (6X) 	<b>15-53998-01 R</b> 2x 13270-AA190 +13293-AA051 (2x)   <b>15-53999-01 L</b> 13272-AA140 +13293-AA051 (2x) 	<b>12-53989-01</b> 13207-AA120 (8x) +13211-AA110 (8x)   <b>70-53989-00 ES</b> 8x 13207-AA120   <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-17780-00</b>   2x 14035-AA540   <b>71-53941-00</b>  2x 14035-AA421   <b>71-52938-10</b>  2x 44616-AA291 	<b>70-31414-10</b> 	<b>81-53918-00 K</b>  80673-3030 33x49 A SL RD FPM   <b>81-53333-00 K</b>  80678-6040 86x103 A SL LD MVQ   <b>81-53944-00 N</b>  2x 80673-2160 32x55 A SL RD FPM   <b>81-54006-00 N</b>  2x 80674-2160 42x55 A SL RD FPM 
2,0	EJ204	118-121 kW (160-165 PS)	LEGACY	09/03-04/09					<b>61-10199-00</b> 2x 11044-AA651 93,7 Ø MLS 	<b>14-11012-01</b> 2x 11095-AA042 (6X) 	<b>15-53998-01 R</b> 2x 13270-AA190 +13293-AA051 (2x)   <b>15-53999-01 L</b> 13272-AA140 +13293-AA051 (2x) 	<b>12-53989-01</b> 13207-AA120 (8x) +13211-AA110 (8x)   <b>70-53989-00 ES</b> 8x 13207-AA120   <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-17438-00</b>  2x 16272-AA001   <b>71-17461-00</b>   2x 14035-AA492   <b>71-54001-00</b>  2x 14038-AA000 	<b>70-31414-10</b> 	<b>81-53918-00 K</b>  80673-3030 33x49 A SL RD FPM   <b>81-53333-00 K</b>  80678-6040 86x103 A SL LD MVQ   <b>81-54006-00 N</b>  4x 80674-2160 42x55 A SL RD FPM 


## SUBARU

Ltr.  2,0 EJ205 125-160 kW (170-218 PS) FORESTER IMPREZA  06/98-04/01




01-53940-01

10105-AA351




02-53940-01

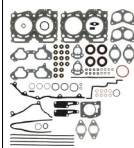

61-53940-00 2x

11044-AA483  
93,7 Ø  
MLS




15-53946-01 R

13270-AA171  
+13293-AA051 (2x)  
1 01/99




15-53947-01 R

13270-AA162  
+13293-AA051 (2x)  
1 02/99→




15-53948-01 L

13272-AA094  
+13293-AA051 (2x)



12-53919-01

13207-AA050 (8x)  
+13211-AA050 (8x)



71-53941-00 L


14035-AA421



71-52938-10 2x



70-31414-10



81-53918-00 K

80673-3030  
33x49  
A SL RD FPM



81-53333-00 K

80678-6040  
86x103  
A SL LD MVQ



81-53944-00 N 4x


80673-2160  
32x55  
A SL RD FPM



2,0 EJ205 130-169 kW (177-230 PS) FORESTER IMPREZA IMPREZA WRX 12/00-03/07

01-53940-01

10105-AA351



02-53940-01



61-53940-00 2x

11044-AA483  
93,7 Ø  
MLS



15-53947-01 R

13270-AA162  
+13293-AA051 (2x)



15-53948-01 L

13272-AA094  
+13293-AA051 (2x)



12-53919-01

13207-AA050 (8x)  
+13211-AA050 (8x)



71-53941-00 L 2x

14035-AA421



71-52938-10 2x



70-31414-10



81-53918-00 K

80673-3030  
33x49  
A SL RD FPM



81-53333-00 K

80678-6040  
86x103  
A SL LD MVQ
















































81-53944-00 N 4x

80673-2160  
32x55  
A SL RD FPM






































SUBARU

Ltr.														
2,0	EJ205	150-184 kW (204-250 PS)	IMPREZA	12/01-03/07	<b>01-53940-01</b> 10105-AA351 	<b>02-53940-01</b> 		<b>61-53940-00</b> 2x 11044-AA483 93,7 Ø MLS 		<b>15-53947-01 R</b> 13270-AA162 +13293-AA051 (2x)   <b>15-53948-01 L</b> 13272-AA094 +13293-AA051 (2x) 	<b>12-53919-01</b> 13207-AA050 (8x) +13211-AA050 (8x) 	<b>71-53941-00 L</b> 2x 14035-AA421   <b>71-52938-10</b> 2x 44616-AA291   <b>71-53942-00</b> 10   <b>71-53943-00</b> 10 	<b>70-31414-10</b> 	<b>81-53918-00 K</b>  80673-3030 33x49 A SL RD FPM  <b>81-53333-00 K</b>  80678-6040 86x103 A SL LD MVQ  <b>81-53944-00 N</b> 4x 80673-2160 32x55 A SL RD FPM 
2,0	EJ207	195-224 kW (265-305 PS)	IMPREZA	04/01-07/05	<b>01-53940-01</b> 10105-AA351 	<b>02-53940-01</b> 		<b>61-53940-00</b> 2x 11044-AA483 93,7 Ø MLS 	<b>14-11012-01</b> 2x 11095-AA042 (6x) 	<b>15-20113-01 X R</b> 13270-AA152 +13293-AA051 (2x)   <b>15-20119-01 X L</b> 13272-AA075 +13293-AA051 (2x) 	<b>12-53989-01</b> 13207-AA120 (8x) +13211-AA110 (8x)   <b>70-53989-00 ES</b> 8x 13207-AA120   <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-53941-00 L</b> 2x 14035-AA421   <b>71-54002-00 L</b> 2x 14075-AA161   <b>71-54001-00</b> 2x 14038-AA000 	<b>70-31414-10</b> 	<b>81-53918-00 K</b>  80673-3030 33x49 A SL RD FPM  <b>81-53333-00 K</b>  80678-6040 86x103 A SL LD MVQ  <b>81-53944-00 N</b> 2x 80673-2160 32x55 A SL RD FPM   <b>81-54006-00 N</b> 2x 80674-2160 42x55 A SL RD FPM 






















SUBARU

Ltr.  2,0 EJ207 235 kW (320 PS) IMPREZA  02/04-07/05  1























										
				<b>61-53940-00</b> 2x 11044-AA483 93,7 Ø MLS 	<b>14-11012-01</b> 2x 11095-AA042 (6x) 	<b>15-20113-01</b>  R 13270-AA152 +13293-AA051 (2x)  <b>15-20119-01</b>  L 13272-AA075 +13293-AA051 (2x) 	<b>12-53989-01</b> 13207-AA120 (8x) +13211-AA110 (8x)  <b>70-53989-00 ES</b> 8x 13207-AA120  <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-53941-00</b>  2x 14035-AA421  <b>71-54002-00</b>  9) 2x 14075-AA161  <b>71-54001-00</b> 2x 14038-AA000 	<b>70-31414-10</b> 	<b>81-53918-00</b>  80673-3030 33x49 A SL RD FPM  <b>81-53333-00</b>  80678-6040 86x103 A SL LD MVQ  <b>81-53944-00</b>  2x 80673-2160 32x55 A SL RD FPM  <b>81-54006-00</b>  2x 80674-2160 42x55 A SL RD FPM 

2,0 EJ208 206 kW (280 PS) LEGACY 06/02-12/14


01-53940-01 10105-AA351 	02-53940-01 	61-53940-00 2x 11044-AA483 93,7 Ø MLS 	14-11012-01 2x 11095-AA042 (6X) 	15-53947-01 R 13270-AA162 +13293-AA051 (2x)  15-53948-01 L 13272-AA094 +13293-AA051 (2x) 	12-53989-01 13207-AA120 (8x) +13211-AA110 (8x)  70-53989-00 ES 8x 13207-AA120  70-53991-00 AS 8x 13211-AA110 	71-53941-00  2x 14035-AA421  71-54001-00 14038-AA000 	70-31414-10 	81-53918-00  80673-3030 33x49 A SL RD FPM  81-53333-00  80678-6040 86x103 A SL LD MVQ  81-53944-00  4x 80673-2160 32x55 A SL RD FPM 
--	--	---	---	--	--	---	--	---

















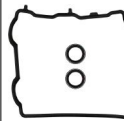
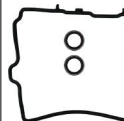
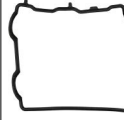






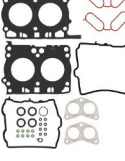


SUBARU

Ltr.  2,0 FA20 FA20E FA20F 177-206 kW (240-280 PS) FORESTER FORESTER XT IMPREZA LEGACY D OUTBACK D WRX 03/13  1

























										
01-10266-01 10105-AB560	02-10266-01			<b>61-10266-00 L</b> 10944-AA110 89,5 Ø 0,5 mm MLS 	<b>14-11012-01</b> 11095-AA042 (6x) 	2x <b>15-10675-01 R</b> 13270-AA250 +10966-AA040 (2X) 	<b>12-10695-01</b> 13207-AA110 (8x) +13211-AA100 (8x)  <b>70-10695-00 AS</b> 13211-AA100  <b>70-11562-00 ES</b> 13207-AA110 	<b>11-12989-01 L</b> 14035-AA620 (4x)  <b>71-12987-00</b> 2x 14038-AA050 	<b>70-31414-10</b> 	<b>81-53387-00 K</b> 80675-0070 50x62 RD  <b>81-10384-00 K</b> 80679-2010 92x109 A SL LD FPM 

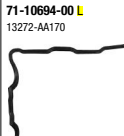SUBARU

Ltr.  2,0 FA20D 147-153 kW (200-208 PS) BRZ 06/12












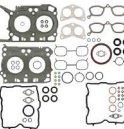
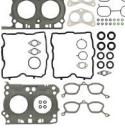



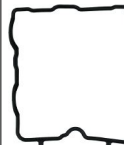

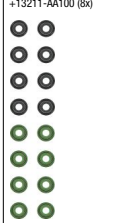








										
<p><b>01-10080-01</b> 10105-AB550</p> 	<p><b>02-10080-01</b></p> 			<p><b>61-10080-00 L</b> 10944-AA100 89,5 Ø 0,5 mm MLS</p>  <p><b>61-10081-00 R</b> 11044-AA810 89,5 Ø 0,5 mm MLS</p> 	<p><b>14-11012-01</b> 11095-AA042 (6X)</p>  <p>2x</p>	<p><b>15-10675-01 R</b> 13270-AA250 +10966-AA040 (2X)</p>  <p><b>15-10676-01 L</b> 13272-AA180 +10966-AA040 (2X)</p>  <p><b>71-10675-00 R</b> 13270-AA250</p>  <p><b>71-10676-00 L</b> 13272-AA180</p> 	<p><b>12-10695-01</b> 13207-AA110 (8x) +13211-AA100 (8x)</p>  <p><b>70-10695-00 AS</b> 13211-AA100</p>  <p>8x</p> <p><b>70-11562-00 ES</b> 13207-AA110</p>  <p>8x</p>	<p><b>71-10677-00 L</b> 14035-AA610</p>  <p><b>71-52938-10</b> 44616-AA291</p>  <p>2x</p>	<p><b>70-31414-10</b></p> 	<p><b>81-53387-00 K</b> 80675-0070 50x62 RD</p>  <p><b>81-10384-00 K</b> 80679-2010 92x109 A SL LD FPM</p> 

2,0 FB20 110 kW (150 PS) FORESTER IMPREZA LEGACY LEVORG 01/10








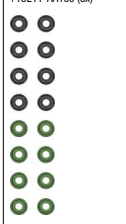






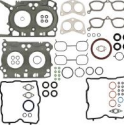

										
<p><b>01-10086-01</b> 10105-AB730</p> 	<p><b>02-10086-01</b></p> 			<p><b>61-10086-00 L</b> 10944-AA070 85,5 Ø 0,5 mm MLS</p>  <p><b>61-10087-00 R</b> 11044-AA780 85,5 Ø 0,5 mm MLS</p> 	<p><b>14-11012-01</b> 11095-AA042 (6X)</p>  <p>2x</p>	<p><b>71-10693-00 R</b> 13270-AA240</p>  <p><b>71-10694-00 L</b> 13272-AA170</p> 	<p><b>12-10695-01</b> 13207-AA110 (8x) +13211-AA100 (8x)</p>  <p><b>70-10695-00 AS</b> 13211-AA100</p>  <p>8x</p> <p><b>70-11562-00 ES</b> 13207-AA110</p>  <p>8x</p>	<p><b>71-10697-00 L</b> 14035-AA580</p>  <p><b>71-52938-10</b> 44616-AA291</p>  <p>2x</p>	<p><b>70-31414-10</b></p> 	<p><b>81-53387-00 K</b> 80675-0070 50x62 RD</p>  <p><b>81-10384-00 K</b> 80679-2010 92x109 A SL LD FPM</p> 

SUBARU

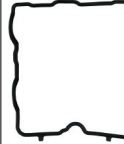
Ltr.  2,0 FB20A 110 kW (150 PS) LEVORG 01/19

										
<b>01-10086-01</b> 10105-AB730 	<b>02-10086-01</b> 			<b>61-10086-00 L</b> 10944-AA070 85,5 Ø 0,5 mm MLS  <b>61-10087-00 R</b> 11044-AA780 85,5 Ø 0,5 mm MLS 	<b>14-11012-01</b> 11095-AA042 (6X) 	<b>71-10693-00 R</b> 13270-AA240  <b>71-10694-00 L</b> 13272-AA170 	<b>12-10695-01</b> 13207-AA110 (8x) +13211-AA100 (8x)  <b>70-10695-00 AS</b> 13211-AA100 8x  <b>70-11562-00 ES</b> 13207-AA110 8x 	<b>71-10697-00 L</b> 14035-AA580  <b>71-16042-00 L</b> 14035-AA570  <b>71-52938-10</b> 44616-AA291 	<b>70-31414-10</b> 	<b>81-53387-00 K</b> 80675-0070 50x62 RD  <b>81-10384-00 K</b> 80679-2010 92x109 A SL LD FPM 


2,0 FB20B 110 kW (150 PS) FORESTER IMPREZA XV 07/11

<b>01-10086-01</b> 10105-AB730 	<b>02-10086-01</b> 			<b>61-10086-00 L</b> 10944-AA070 85,5 Ø 0,5 mm MLS  <b>61-10087-00 R</b> 11044-AA780 85,5 Ø 0,5 mm MLS 	<b>14-11012-01</b> 11095-AA042 (6X) 	<b>71-10693-00 R</b> 13270-AA240  <b>71-10694-00 L</b> 13272-AA170 	<b>12-10695-01</b> 13207-AA110 (8x) +13211-AA100 (8x)  <b>70-10695-00 AS</b> 13211-AA100 8x  <b>70-11562-00 ES</b> 13207-AA110 8x 	<b>71-16042-00 L</b> 14035-AA570  <b>71-10697-00 L</b> 14035-AA580  <b>71-52938-10</b> 44616-AA291 	<b>70-31414-10</b> 	<b>81-53387-00 K</b> 80675-0070 50x62 RD  <b>81-10384-00 K</b> 80679-2010 92x109 A SL LD FPM 
--	---	--	--	---	---	---	--	--	---	--


SUBARU

Ltr. 

















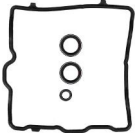

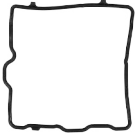
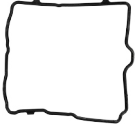








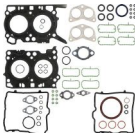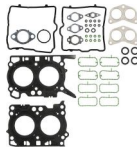2,0 FB20C  
FB20D



FORESTER  
IMPREZA  
XV





10/16


										
<b>01-11327-01</b> 10105-AB740 	<b>02-11327-01</b> 			<b>61-11327-00 R</b> 11044-AA870 87 Ø 0,5 mm MLS   <b>61-11328-00 L</b> 10944-AA160 87 Ø 0,5 mm MLS 	<b>14-11012-01</b> 11095-AA042 (6x) 	2x <b>15-20014-01 R</b> 13270-AA300 +10966-AA041 (2x) +13293-AA060   <b>15-20017-01 L</b> 13272-AA250 +10966-AA041 (2x) +13293-AA060   <b>71-20014-00 R</b> 13270-AA300   <b>71-20017-00 L</b> 13272-AA250 	<b>12-10695-01</b> 13207-AA110 (8x) +13211-AA100 (8x)   <b>70-10695-00 AS</b> 13211-AA100  8x  <b>70-11562-00 ES</b> 13207-AA110  8x	<b>71-20018-00 L</b> 14035-AA690   <b>71-52938-10</b> 44616-AA291  2x	<b>70-31414-10</b> 	<b>81-53387-00 K</b> 80675-0070 50x62 RD   <b>81-10384-00 K</b> 80679-2010 92x109 A SL LD FPM 



SUBARU





Ltr. 





 1



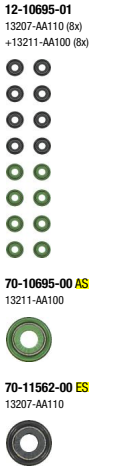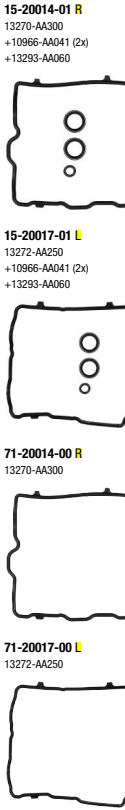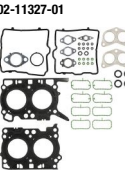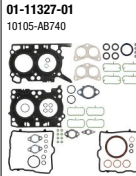


























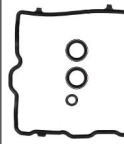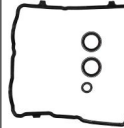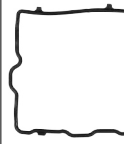














2,0 FB20W

107-110 kW (145-150 PS)




SUBARU

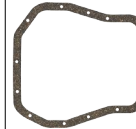Ltr.  2,0 FB20X 107-110 kW (145-150 PS) FORESTER Hybrid 04/18 

										
<p><b>01-11327-01</b> 10105-AB740</p> 	<p><b>02-11327-01</b></p> 			<p><b>61-11327-00 R</b> 11044-AA870 87 Ø 0,5 mm MLS</p>  <p><b>61-11328-00 L</b> 10944-AA160 87 Ø 0,5 mm MLS</p> 	<p><b>14-11012-01</b> 11095-AA042 (6X)</p>  <p>2x</p>	<p><b>15-20014-01 R</b> 13270-AA300 +10966-AA041 (2x) +13293-AA060</p>  <p><b>15-20017-01 L</b> 13272-AA250 +10966-AA041 (2x) +13293-AA060</p>  <p><b>71-20014-00 R</b> 13270-AA300</p>  <p><b>71-20017-00 L</b> 13272-AA250</p> 	<p><b>12-10695-01</b> 13207-AA110 (8x) +13211-AA100 (8x)</p>  <p><b>70-10695-00 AS</b> 13211-AA100 8x</p>  <p><b>70-11562-00 ES</b> 13207-AA110 8x</p> 	<p><b>71-52938-10</b>  2x 44616-AA291</p> 	<p><b>70-31414-10</b></p> 	<p><b>81-53387-00 K</b>  80675-0070 50x62 RD</p>  <p><b>81-10384-00 K</b>  80679-2010 92x109 A SL LD FPM</p> 
<p><b>01-53000-01</b> 10105-AA021</p> 	<p><b>02-53000-01</b></p> 			<p><b>61-53000-00</b> 2x 11044-AA114 98 Ø</p> 		<p><b>71-52951-00</b> 2x 13294-AA010</p> 	<p><b>12-52829-01</b> 14035-AA290</p> 	<p><b>71-52942-00 L</b>  2x 14035-AA290</p>  <p><b>71-52938-10</b>  2x 44616-AA291</p> 	<p><b>71-52946-00</b></p> 	<p><b>81-53333-00 K</b>  80678-6040 86x103 A SL LD MVQ</p>  <p><b>81-53239-00 N</b>  80673-2150 32x45 A SL RD ACM</p> 





SUBARU

Ltr.  2,4 FA24C FA24D 170-174 kW (231-237 PS) BRZ 10/21







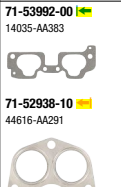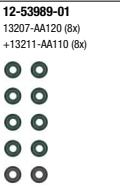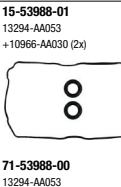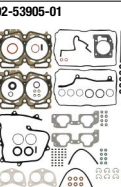






























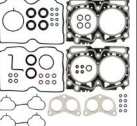









































































14-11012-01 2x 15-20014-01 R 12-10695-01 71-52938-10 2x 70-31414-10 81-10384-00 K

2,5 EJ25 115 kW (156 PS) FORESTER LEGACY OUTBACK 10/98-12/08





























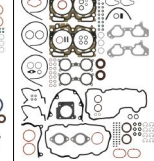








01-53905-01 02-53905-01 61-53920-00 2x 14-11006-03 2x 15-53988-01 2x 12-53989-01 71-53992-00 2x 70-31414-10 81-53918-00 K

SUBARU															
Ltr.															
2,5	EJ25	121-127 kW (165-173 PS)	LEGACY	09/03-12/09	<b>01-53905-03</b> 10105-AB100 				<b>61-53920-00</b> 2x 11044-AA642 101,3 Ø MLS 	<b>14-11006-03</b> 2x 11095-AA123 (4x) +11095-AA141 (2x) 	<b>15-53988-01</b> 2x 13294-AA053 +10966-AA030 (2x)  <b>71-53988-00</b> 2x 13294-AA053 	<b>12-53989-01</b> 2x 13207-AA120 (8x) +13211-AA110 (8x)  <b>70-53989-00 ES</b> 8x 13207-AA120  <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-53992-00</b>  2x 14035-AA383  <b>71-53997-00</b>   2x 14075-AA210  <b>71-52938-10</b>  2x 44616-AA291 	<b>70-31414-10</b> 	<b>81-53918-00</b>  80673-3030 33x49 A SL RD FPM  <b>81-53333-00</b>  80678-6040 86x103 A SL RD MVQ  <b>81-53239-00</b>  2x 80673-2150 32x45 A SL RD ACM 
2,5	EJ25	125 kW (170 PS)	LEGACY OUTBACK	05/09	<b>01-53910-05</b> 10105-AB270 	<b>02-53910-05</b> 			<b>61-53910-00</b> 2x 11044-AA770 101,3 Ø MLS 		<b>71-53996-00</b> 2x 13294-AA070  <b>12-53989-01</b> 2x 13207-AA120 (8x) +13211-AA110 (8x)  <b>70-53989-00 ES</b> 8x 13207-AA120  <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-17780-00</b>  2x 14035-AA540  <b>71-52938-10</b>  2x 44616-AA291 	<b>70-31414-10</b> 	<b>81-53918-00</b>  80673-3030 33x49 A SL RD FPM  <b>81-53333-00</b>  80678-6040 86x103 A SL LD MVQ  <b>81-53239-00</b>  2x 80673-2150 32x45 A SL RD ACM 	


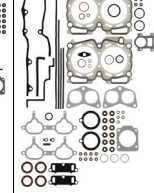

















SUBARU															
Ltr.															
2,5	EJ25	126 kW (171 PS)	FORESTER	01/09-09/13	<b>01-53905-02</b> 10105-AB150 	<b>02-53905-02</b> 			<b>61-53920-00</b> 2x 11044-AA642 101,3 Ø MLS 		<b>71-53996-00</b> 2x 13294-AA070 	<b>12-53989-01</b> 13207-AA120 (8x) +13211-AA110 (8x)  <b>70-53989-00 ES</b> 8x 13207-AA120  <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-53992-00</b>  2x 14035-AA383  <b>71-53997-00</b>   2x 14075-AA210  <b>71-52938-10</b> 2x 44616-AA291 	<b>70-31414-10</b> 	<b>81-53918-00</b>  80673-3030 33x49 A SL RD FPM  <b>81-53333-00</b>  80678-6040 86x103 A SL LD MVQ  <b>81-53239-00</b>  2x 80673-2150 32x45 A SL RD ACM 
2,5	EJ25	127 kW (173 PS)	LEGACY	01/08-12/09	<b>01-53905-02</b> 10105-AB150 	<b>02-53905-02</b> 			<b>61-53920-00</b> 2x 11044-AA642 101,3 Ø MLS 	<b>14-11006-03</b> 2x 11095-AA123 (4x) +11095-AA141 (2x) 	<b>71-53996-00</b> 2x 13294-AA070 	<b>12-53989-01</b> 13207-AA120 (8x) +13211-AA110 (8x)  <b>70-53989-00 ES</b> 8x 13207-AA120  <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-53992-00</b>  2x 14035-AA383  <b>71-53997-00</b>   2x 14075-AA210  <b>71-52938-10</b> 2x 44616-AA291 	<b>70-31414-10</b> 	<b>81-53918-00</b>  80673-3030 33x49 A SL RD FPM  <b>81-53333-00</b>  80678-6040 86x103 A SL LD MVQ  <b>81-53239-00</b>  2x 80673-2150 32x45 A SL RD ACM 
















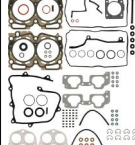



































SUBARU

Ltr.  2,5 EJ25 155 kW (211 PS) FORESTER 12/03-05/05  1
















































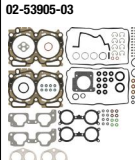




										
01-53920-01 10105-AA600 	02-53920-01 			61-53920-00 2x 11044-AA642 101,3 Ø MLS 	14-11012-01 2x 11095-AA042 (6x) 	15-53998-01 R 13270-AA190 +13293-AA051 (2x)  15-53999-01 L 13272-AA140 +13293-AA051 (2x) 	12-53989-01 13207-AA120 (8x) +13211-AA110 (8x)  70-53989-00 ES 8x 13207-AA120  70-53991-00 AS 8x 13211-AA110 	71-53941-00 L  2x 14035-AA421  71-54002-00 L  0 14075-AA161 	70-31414-10 	81-53918-00 K  80673-3030 33x49 A SL RD FPM  81-53333-00 K  80678-6040 86x103 A SL LD MVQ  81-53944-00 N  80673-2160 32x55 A SL RD FPM  81-54006-00 N  80674-2160 42x55 A SL RD FPM 

2,5 EJ25D 110-123 kW (150-167 PS) FORESTER LEGACY LEGACY OUTBACK 01/96-05/08

01-53915-01 10105-AA401 	02-53915-01 			61-53915-00 2x 11044-AA610 101 Ø MLS 		15-53933-01 R 13270-AA111 +13293-AA051 (2x)  320928→  15-53937-01 L 13272-AA111 +13293-AA051 (2x)  320928→ 	12-53919-01 13207-AA050 (8x) +13211-AA050 (8x) 	71-53921-00 L  2x 14035-AA281  71-52938-10  2x 44618-AA291 	70-31414-10 	81-53918-00 K  80673-3030 33x49 A SL RD FPM  81-53333-00 K  80678-6040 86x103 A SL LD MVQ  81-53239-00 N  4x 80673-2150 32x45 A SL RD ACM 
---	---	--	--	--	--	--	--	--	--	---

SUBARU															
Ltr.															
2,5	EJ251	112-130 kW (152-177 PS)	FORESTER IMPREZA OUTBACK	03/01-06/10	<b>01-53905-01</b> 10105-AA860 	<b>02-53905-01</b> 		<b>61-53920-00</b> 2x 11044-AA642 101,3 Ø MLS 		<b>71-53988-00</b> 2x 13294-AA053 	<b>12-53989-01</b> 13207-AA120 (8x) +13211-AA110 (8x)  <b>70-53989-00 ES</b> 8x 13207-AA120  <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-53992-00</b>  2x 14035-AA383  <b>71-52938-10</b>  2x 44616-AA291 	<b>70-31414-10</b> 	<b>81-53918-00</b>  80673-3030 33x49 A SL RD FPM  <b>81-53333-00</b>  80678-6040 86x103 A SL RD MVQ  <b>81-53239-00</b>  2x 80673-2150 32x45 A SL RD ACM 	
2,5	EJ253	123 kW (167 PS)	LEGACY OUTBACK	09/09	<b>01-53910-05</b> 10105-AB270 	<b>02-53910-05</b> 		<b>61-53910-00</b> 2x 11044-AA770 101,3 Ø MLS 	<b>14-11006-03</b> 2x 11095-AA123 (4x) +11095-AA141 (2x) 	<b>71-53996-00</b> 2x 13294-AA070 	<b>12-53989-01</b> 13207-AA120 (8x) +13211-AA110 (8x)  <b>70-53989-00 ES</b> 8x 13207-AA120  <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-17780-00</b>  2x 14035-AA540  <b>71-52938-10</b>  2x 44616-AA291 	<b>70-31414-10</b> 	<b>81-53918-00</b>  80673-3030 33x49 A SL RD FPM  <b>81-53333-00</b>  80678-6040 86x103 A SL LD MVQ  <b>81-53239-00</b>  2x 80673-2150 32x45 A SL RD ACM 	



SUBARU															
Ltr.															
2,5	EJ253	123-129 kW (167-175 PS)	LEGACY OUTBACK	01/10-12/14	<b>01-53910-05</b> 10105-AB270 	<b>02-53910-05</b> 			<b>61-53910-00</b> 2x 11044-AA770 101,3 Ø MLS 	<b>14-11006-03</b> 2x 11095-AA123 (4x) +11095-AA141 (2x) 	<b>71-53996-00</b> 2x 13294-AA070 	<b>12-53989-01</b> 2x 13207-AA120 (8x) +13211-AA110 (8x)  <b>70-53989-00 ES</b> 8x 13207-AA120  <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-17780-00</b>  2x 14035-AA540  <b>71-52938-10</b>  2x 44616-AA291 	<b>70-31414-10</b> 	<b>81-53918-00</b>  80673-3030 33x49 A SL RD FPM  <b>81-53333-00</b>  80678-6040 86x103 A SL LD MVQ  <b>81-53239-00</b>  2x 80673-2150 32x45 A SL RD ACM 
2,5	EJ253	129 kW (175 PS)	FORESTER	01/05-10/12	<b>01-53905-03</b> 10105-AB100 	<b>02-53905-03</b> 			<b>61-53920-00</b> 2x 11044-AA642 101,3 Ø MLS 	<b>14-11006-03</b> 2x 11095-AA123 (4x) +11095-AA141 (2x) 	<b>15-53988-01</b> 2x 13294-AA053 +10966-AA030 (2x)  <b>71-53988-00</b> 2x 13294-AA053 	<b>12-53989-01</b> 2x 13207-AA120 (8x) +13211-AA110 (8x)  <b>70-53989-00 ES</b> 8x 13207-AA120  <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-53992-00</b>  2x 14035-AA383  <b>71-52938-10</b> 2x 44616-AA291 	<b>70-31414-10</b> 	<b>81-53918-00</b>  80673-3030 33x49 A SL RD FPM  <b>81-53333-00</b>  80678-6040 86x103 A SL LD MVQ  <b>81-53239-00</b>  2x 80673-2150 32x45 A SL RD ACM 

SUBARU

Ltr.  2,5 EJ255 169-195 kW (230-265 PS) FORESTER FORESTER Turbo IMPREZA  01/08 









61-53910-00 2x  
11044-AA770  
101,3 Ø  
MLS  


14-11012-01 2x  
11095-AA042 (6X)  


15-53998-01 R 2x  
13270-AA190  
+13293-AA051 (2x)  
  
15-53999-01 L  
13272-AA140  
+13293-AA051 (2x)  


12-53989-01  
13207-AA120 (8x)  
+13211-AA110 (8x)  
  
70-53989-00 ES 8x  
13207-AA120  
  
70-53991-00 AS 8x  
13211-AA110  


71-53941-00  2x  
14035-AA421  
  
71-17461-00  4x  
14035-AA492  
  
71-54001-00  2x  
14038-AA000  


70-31414-10  




81-53918-00  2x  
80673-3030  
33x49  
A SL RD FPM  
  
81-53333-00  2x  
80678-6040  
86x103  
A SL LD MVQ  
  
81-53944-00  2x  
80673-2160  
32x55  
A SL RD FPM  
  
81-54006-00  2x  
80674-2160  
42x55  
A SL RD FPM  


2,5 EJ255 169-200 kW (230-272 PS) FORESTER IMPREZA 05/05-12/08



61-53910-00 2x  
11044-AA770  
101,3 Ø  
MLS  


14-11012-01 2x  
11095-AA042 (6X)  


15-53998-01 R 2x  
13270-AA190  
+13293-AA051 (2x)  
  
15-53999-01 L  
13272-AA140  
+13293-AA051 (2x)  




12-53989-01  
13207-AA120 (8x)  
+13211-AA110 (8x)  
  
70-53989-00 ES 8x  
13207-AA120  
  
70-53991-00 AS 8x  
13211-AA110  


71-53941-00  2x  
14035-AA421  
  
71-54002-00  2x  
14075-AA161  
  
71-54001-00  2x  
14038-AA000  


70-31414-10  


81-53918-00  2x  
80673-3030  
33x49  
A SL RD FPM  
  
81-53333-00  2x  
80678-6040  
86x103  
A SL LD MVQ  
  
81-53944-00  2x  
80673-2160  
32x55  
A SL RD FPM  
  
81-54006-00  2x  
80674-2160  
42x55  
A SL RD FPM  


SUBARU

Ltr.  2,5 EJ255 188 kW (255 PS) IMPREZA WRX 02/09-12/10  1



**61-53910-00** 2x  
11044-AA770  
101,3 Ø  
MLS



**14-11012-01** 2x  
11095-AA042 (6X)




**15-53998-01 R**  
13270-AA190  
+13293-AA051 (2x)



**15-53999-01 L**  
13272-AA140  
+13293-AA051 (2x)



**12-53989-01**  
13207-AA120 (8x)  
+13211-AA110 (8x)

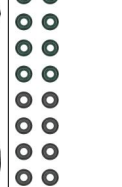


**70-53989-00 ES** 8x  
13207-AA120



**70-53991-00 AS** 8x  
13211-AA110



**71-53941-00 L** 2x  
14035-AA421



**71-54002-00 L** 2x  
14075-AA161



**71-54001-00** 2x  
14038-AA000



**70-31414-10**  




**81-53918-00 K**  
80673-3030  
33x49  
A SL RD FPM



**81-53333-00 K**  
80678-6040  
86x103  
A SL LD MVQ



**81-53944-00 N** 2x  
80673-2160  
32x55  
A SL RD FPM



**81-54006-00 N** 2x  
80674-2160  
42x55  
A SL RD FPM



2,5 EJ255 195 kW (265 PS) IMPREZA WRX 01/09-12/14

**61-53910-00** 2x  
11044-AA770  
101,3 Ø  
MLS




**14-11012-01** 2x  
11095-AA042 (6X)




**15-53998-01 R**  
13270-AA190  
+13293-AA051 (2x)



**15-53999-01 L**  
13272-AA140  
+13293-AA051 (2x)



**12-53989-01**  
13207-AA120 (8x)  
+13211-AA110 (8x)

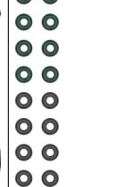


**70-53989-00 ES** 8x  
13207-AA120



**70-53991-00 AS** 8x  
13211-AA110



**71-53941-00 L** 2x  
14035-AA421



**71-54002-00 L** 2x  
14075-AA161



**71-54001-00** 2x  
14038-AA000



**70-31414-10**  




**81-53918-00 K**  
80673-3030  
33x49  
A SL RD FPM




**81-53333-00 K**  
80678-6040  
86x103  
A SL LD MVQ















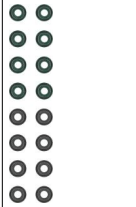











**81-54006-00 N** 4x  
80674-2160  
42x55  
A SL RD FPM









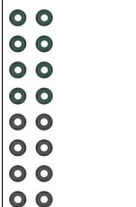



























































SUBARU

Ltr.  2,5 EJ255 195 kW (265 PS)  LEGACY  1 07/10-12/14

										
				<b>61-53910-00</b> 2x 11044-AA770 101.3 Ø MLS 	<b>14-11012-01</b> 2x 11095-AA042 (6x) 	<b>15-53999-01</b> L 2x 13272-AA140 +13293-AA051 (2x) 	<b>12-53989-01</b> 13207-AA120 (8x) +13211-AA110 (8x)  <b>70-53989-00 ES</b> 8x 13207-AA120  <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-53941-00</b> L 2x 14035-AA421  <b>71-17461-00</b> L 4x 14035-AA492  <b>71-54001-00</b> 2x 14038-AA000 	<b>70-31414-10</b> 	<b>81-53918-00</b> K 2x 80673-3030 33x49 A SL RD FPM  <b>81-53333-00</b> K 2x 80678-6040 86x103 A SL LD MVQ  <b>81-54006-00</b> N 4x 80674-2160 42x55 A SL RD FPM 

















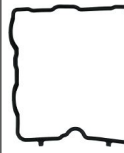

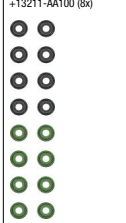









2,5 EJ257 195-221 kW (265-300 PS) IMPREZA 09/05-12/07
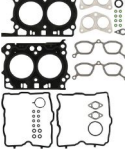
<b>01-53910-01</b> 10105-AB010 1 06/06  <b>01-53910-02</b> 10105-AB080 1 07/06→ 	<b>02-53910-01</b> 1 06/06  <b>02-53910-02</b> 1 07/06→ 			<b>61-53910-00</b> 2x 11044-AA770 101.3 Ø MLS 	<b>14-11012-01</b> 2x 11095-AA042 (6x) 	<b>15-53998-01</b> R 2x 13270-AA190 +13293-AA051 (2x)  <b>15-53999-01</b> L 2x 13272-AA140 +13293-AA051 (2x) 	<b>12-53989-01</b> 13207-AA120 (8x) +13211-AA110 (8x)  <b>70-53989-00 ES</b> 8x 13207-AA120  <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-53941-00</b> L 2x 14035-AA421  <b>71-54002-00</b> L 2x 14075-AA161  <b>71-54001-00</b> 2x 14038-AA000 	<b>70-31414-10</b> 	<b>81-53918-00</b> K 2x 80673-3030 33x49 A SL RD FPM  <b>81-53333-00</b> K 2x 80678-6040 86x103 A SL LD MVQ  <b>81-53944-00</b> N 2x 80673-2160 32x55 A SL RD FPM  <b>81-54006-00</b> N 2x 80674-2160 42x55 A SL RD FPM 
--	--	--	--	---	--	--	---	---	---	---








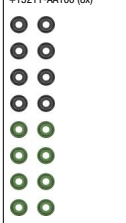






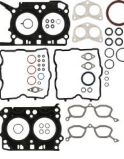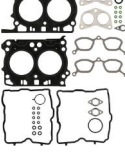

SUBARU														
Ltr.														
2,5	EJ257	199-294 kW (270-400 PS)	IMPREZA IMPREZA WRX WRX	01/08	<b>01-53910-03</b> 10105-AB200 	<b>02-53910-03</b> 		<b>61-53910-00</b> 2x 11044-AA770 101,3 Ø MLS 	<b>14-11012-01</b> 2x 11095-AA042 (6x) 	<b>15-53998-01 R</b> 13270-AA190 +13293-AA051 (2x)   <b>15-53999-01 L</b> 13272-AA140 +13293-AA051 (2x) 	<b>12-53989-01</b> 13207-AA120 (8x) +13211-AA110 (8x)   <b>70-53989-00 ES</b> 8x 13207-AA120   <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-53941-00 L</b> 2x 14035-AA421   <b>71-54002-00 L</b> 2x 14075-AA161   <b>71-54001-00</b> 2x 14038-AA000 	<b>70-31414-10</b> 	<b>81-53918-00 K</b> 80673-3030 33x49 A SL RD FPM   <b>81-53333-00 K</b> 80678-6040 86x103 A SL LD MVQ   <b>81-54006-00 N</b> 4x 80674-2160 42x55 A SL RD FPM 
2,5	EJ257	235-243 kW (320-330 PS)	IMPREZA IMPREZA WRX	02/07-12/10	<b>01-53910-02</b> 10105-AB080 	<b>02-53910-02</b> 		<b>61-53910-00</b> 2x 11044-AA770 101,3 Ø MLS 	<b>14-11012-01</b> 2x 11095-AA042 (6x) 	<b>15-53998-01 R</b> 13270-AA190 +13293-AA051 (2x)   <b>15-53999-01 L</b> 13272-AA140 +13293-AA051 (2x) 	<b>12-53989-01</b> 13207-AA120 (8x) +13211-AA110 (8x)   <b>70-53989-00 ES</b> 8x 13207-AA120   <b>70-53991-00 AS</b> 8x 13211-AA110 	<b>71-53941-00 L</b> 2x 14035-AA421   <b>71-54002-00 L</b> 2x 14075-AA161   <b>71-54001-00</b> 2x 14038-AA000 	<b>70-31414-10</b> 	<b>81-53918-00 K</b> 80673-3030 33x49 A SL RD FPM   <b>81-53333-00 K</b> 80678-6040 86x103 A SL LD MVQ   <b>81-53944-00 N</b> 2x 80673-2160 32x55 A SL RD FPM   <b>81-54006-00 N</b> 2x 80674-2160 42x55 A SL RD FPM 

SUBARU

Ltr.  2,5 FB25 126 kW (171 PS) FORESTER 11/12

										
01-10259-01 10105-AB580 	02-10259-01 			61-10259-00 L 10944-AA080 95,6 Ø 0,5 mm MLS   61-10260-00 R 11044-AA790 95,6 Ø 0,5 mm MLS 	14-11012-01 11095-AA042 (6x) 	2x 71-10693-00 R 13270-AA240   71-10694-00 L 13272-AA170 	12-10695-01 13207-AA110 (8x) +13211-AA100 (8x)   70-10695-00 AS 13211-AA100 8x   70-11562-00 ES 13207-AA110 8x 	71-10697-00 L 14035-AA580   71-16042-00 X 14035-AA570   71-12997-00 X 14035-AA570 2x   71-52938-10 44616-AA291 2x 	70-31414-10 	81-53387-00 K 80675-0070 50x62 RD   81-10384-00 K 80679-2010 92x109 A SL LD FPM 

2,5 FB25 126-127 kW (171-173 PS) FORESTER 03/11

01-10259-01 10105-AB580 	02-10259-01 			61-10259-00 L 10944-AA080 95,6 Ø 0,5 mm MLS   61-10260-00 R 11044-AA790 95,6 Ø 0,5 mm MLS 	14-11012-01 11095-AA042 (6x) 	2x 71-10693-00 R 13270-AA240   71-10694-00 L 13272-AA170 	12-10695-01 13207-AA110 (8x) +13211-AA100 (8x)   70-10695-00 AS 13211-AA100 8x   70-11562-00 ES 13207-AA110 8x 	71-10697-00 L 14035-AA580   71-16042-00 X 14035-AA570   71-52938-10 44616-AA291 2x 	70-31414-10 	81-53387-00 K 80675-0070 50x62 RD   81-10384-00 K 80679-2010 92x109 A SL LD FPM 
---	--	--	--	---	--	---	--	---	--	--

SUBARU

Ltr.  2,5 FB25 127 kW (173 PS) LEGACY 07/12-12/14




01-10259-01  
10105-AB580




01-10259-02  
10105-AB700



02-10259-01

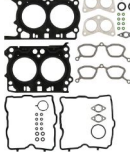

02-10259-02

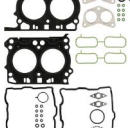

61-10259-00 L

10944-AA080  
95,6 Ø  
0,5 mm  
MLS



61-10260-00 R

11044-AA790  
95,6 Ø  
0,5 mm  
MLS



14-11012-01

11095-AA042 (6X)



71-10693-00 R

13270-AA240




71-10693-00 R

13270-AA240



71-10694-00 L

13272-AA170

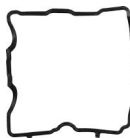


71-10694-00 L



12-10695-01

13207-AA110 (8x)  
+13211-AA100 (8x)

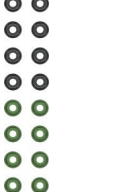


70-10695-00 AS

13211-AA100



70-11562-00 ES

13207-AA110



71-10697-00 L

14035-AA580



71-18107-00 L

14035-AA680



71-52938-10

44616-AA291



70-31414-10



81-53387-00 K

80675-0070  
50x62  
RD



81-10384-00 K


80679-2010  
92x109  
A SL LD FPM



2,5 FB25  
FB25C  
FB25D 129-136 kW (175-185 PS) FORESTER  
LEGACY  
OUTBACK 07/14


01-10259-02

10105-AB700

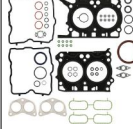

02-10259-02

10105-AB700

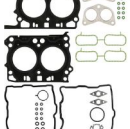

61-10259-00 L

10944-AA080

95,6 Ø  
0,5 mm  
MLS



61-10260-00 R

11044-AA790

95,6 Ø  
0,5 mm  
MLS



14-11012-01

11095-AA042 (6X)




71-10693-00 R

13270-AA240



71-10694-00 L

13272-AA170

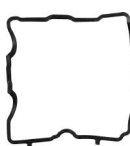

12-10695-01

13207-AA110 (8x)  
+13211-AA100 (8x)



70-10695-00 AS

13211-AA100



70-11562-00 ES

13207-AA110



71-18107-00 L

14035-AA680



71-52938-10

44616-AA291



70-31414-10



81-53387-00 K

80675-0070  
50x62  
RD



81-10384-00 K

















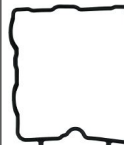
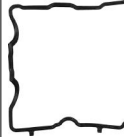
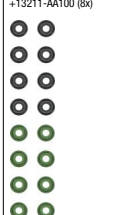







80679-2010  
92x109  
A SL LD FPM

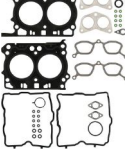








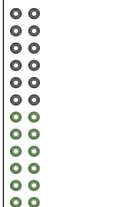









SUBARU



Ltr.  2,5 FB25A FB25B 127 kW (173 PS) LEGACY OUTBACK 07/12




























										
<p><b>01-10259-01</b> 10105-AB580</p> 	<p><b>02-10259-01</b></p> 			<p><b>61-10259-00 L</b> 10944-AA080 95,6 Ø 0,5 mm MLS</p>  <p><b>61-10260-00 R</b> 11044-AA790 95,6 Ø 0,5 mm MLS</p> 	<p><b>14-11012-01</b> 11095-AA042 (6x)</p> 	<p><b>71-10693-00 R</b> 13270-AA240</p>  <p><b>71-10694-00 L</b> 13272-AA170</p> 	<p><b>12-10695-01</b> 13207-AA110 (8x) +13211-AA100 (8x)</p>  <p><b>70-10695-00 AS</b> 13211-AA100 8x</p>  <p><b>70-11562-00 ES</b> 13207-AA110 8x</p> 	<p><b>71-10697-00 L</b> 14035-AA580</p>  <p><b>71-52938-10</b> 44616-AA291 2x</p> 	<p><b>70-31414-10</b></p> 	<p><b>81-53387-00 K</b> 80675-0070 50x62 RD</p>  <p><b>81-10384-00 K</b> 80679-2010 92x109 A SL LD FPM</p> 

3,0 EZ30 180-184 kW (245-250 PS) LEGACY OUTBACK TRIBECA 09/03

<p><b>01-11244-01</b> 10105-AA790</p> 	<p><b>02-11244-01</b></p> 			<p><b>61-11244-00 R</b> 10944-AA010 90 Ø MLS</p>  <p><b>61-11245-00 L</b> 11044-AA660 90 Ø MLS</p> 	<p><b>14-11605-01</b> 11095-AA021 (8x)</p> 	<p><b>15-11479-01 L</b> 13272-AA130 +13293-AA051 (3x)</p>  <p><b>15-11480-01 R</b> 13270-AA180 +13293-AA051 (3x)</p> 	<p><b>12-10695-02</b> 13207-AA110 (12x) +13211-AA100 (12x)</p>  <p><b>70-10695-00 AS</b> 13211-AA100 12x</p>  <p><b>70-11562-00 ES</b> 13207-AA110 12x</p> 	<p><b>71-11481-00 L</b> 14035-AA460</p>  <p><b>71-11482-00</b> 44011-AG040 2x</p> 	<p><b>70-31414-10</b></p> 	<p><b>81-10456-00 K</b> 806738200 38,5x50,5 A SL RD FPM</p>  <p><b>81-53333-00 K</b> 80678-6040 86x103 A SL LD MVQ</p> 
---	---	--	--	---	--	--	---	--	---	---

SUBARU

Ltr.  3,6 EZ36D 183-206 kW (249-280 PS)  LEGACY OUTBACK TRIBECA  09/07

										
<b>01-11363-01</b> 10105-AB690 	<b>02-11363-01</b> 			<b>61-11249-00 R</b> 11044-AA720 93 Ø 0,7 mm MLS 	<b>14-11605-01</b> 11095-AA021 (8x) 	2x <b>15-21567-01 R</b> 13270-AA210 +13293-AA051 (3x)  	<b>12-10695-02</b> 13207-AA110 (12x) +13211-AA100 (12x) 	<b>71-11481-00</b>  6x 14035-AA460  <b>71-11482-00</b>  2x 44011-AG040 	<b>70-31414-10</b> 	<b>81-10456-00 K</b>  806738200 38,5x50,5 A SL RD FPM  <b>81-53333-00 K</b>  80678-6040 86x103 A SL LD MVQ 

# Haftungsausschluss

## (für Katalog)

**Alle Angaben in unserem Katalog** wurden von uns sorgfältig geprüft, sind jedoch unverbindlich. Ersatzansprüche wegen Katalogangaben werden von uns nicht anerkannt. Der Käufer ist selbst verpflichtet, zu prüfen, ob unsere Teile für seine Zwecke geeignet sind. In allen Zweifelsfällen sollte Rücksprache mit unserem technischen Kundendienst erfolgen **Tel. +49 731 7046 999**.

**Technische Weiterentwicklungen** oder Änderungen bleiben vorbehalten, soweit damit keine Nachteile für den Kunden verbunden sind.

**Angaben, Namens- und Markenzeichen**, Beschreibungen, Nummern von Fahrzeugnummern und Herstellerzeichen, Original-Ersatzteilnummern der Fahrzeug- und Motorenhersteller u. a. sind ausschließlich für interne Zwecke gedacht. Solche Kennzeichnungen dürfen Fahrzeugbesitzern gegenüber nicht verwendet werden.

**Wir weisen ausdrücklich darauf hin**, dass alle von uns gelieferten Teile von geschultem Fachpersonal einzubauen sind. Reinz haftet für Fehler in diesem Katalog nur, wenn diese für den Kunden nicht offenbar erkennbar sind sowie nur bei Vorsatz und grober Fahrlässigkeit von Reinz, eines Vertreters oder eines Erfüllungsgehilfen. Dieser Haftungsausschluss gilt nicht im Rahmen

des Anwendungsbereichs des Produkthaftungsgesetzes und nicht bei Verletzung von Körper, Leben und Gesundheit, sowie bei der Verletzung von sog. Kardinalpflichten. Darüber hinaus ist unsere Haftung für Schäden, insbesondere für Personen-, Sach- oder Vermögensschäden, die unmittelbar oder mittelbar im Zusammenhang mit der Nutzung dieses Kataloges auftreten, sowie für nicht voraussehbare Schäden ausgeschlossen.

**Reinz ist Inhaber aller Schutzrechte** an den in diesem Katalog gespeicherten Daten. Kopie, Nachdruck, ganze oder teilweise Übernahme der Inhalte und Vervielfältigung, auch auszugsweise, ist nur mit unserer vorheriger schriftlichen Zustimmung sowie mit unserem Urheberrechtsvermerk zulässig.

Für Bestellungen, welche ab dem Erscheinungsdatum eines neuen Katalogs getätigt werden, sind alleine die Angaben des neuen Katalogs maßgeblich. Auf Angaben im Vorkatalog kann bei Neubestellungen nicht mehr zurückgegriffen werden.

**Sofern Sie noch Fragen haben, bitten wir Sie, sich mit uns in Verbindung zu setzen.**

VictorReinz.com/AGB

# Exclusion of Liability

## (for catalog)

**All details in our catalog** have been thoroughly checked by us but are however not binding. Right to damages on account of catalog details will not be recognized. The purchaser is obliged to check if our parts are suitable for their use. In all doubtful cases, the purchaser should consult our technical customer service under **+49 731 7046 999**.

**We reserve the right** to further technical developments or changes as long as no disadvantage for the customer results.

**Details, name and trademarks**, descriptions, numbers from vehicle numbers and manufacturer symbols, original vehicle replacement part numbers and engine manufacturer etc. are solely for internal use. Such labels must not be used with vehicle owners.

**We specifically point out** that all parts supplied by us must be assembled by trained specialists.

**Reinz is liable for mistakes** in this catalog only when they are not clearly recognizable for the customer, as well as by intent or gross negligence on the part of Reinz, it's representative or vicarious agent. This exclusion of liability does not apply within the framework of the field of

application of the product liability laws and not by bodily harm, life and health, as well as by violation of cardinal duties. In addition, our liability for damages, especially personal, property or financial damages that occur directly or indirectly as a result of the use of this catalog, as well as non-foreseeable damages are excluded.

**Reinz is the owner of all patent rights** on the data stored in this catalog. Copies, reprints, whole or partial takeover of the contents and duplication even in excerpts are only permissible with our prior written approval, as well as with our copyright note.

**For orders placed after the publication date** of a new catalog, only the details in the new catalog are binding and no fall back to details in the previous catalog is possible.

**In case you have further questions, do not hesitate to contact us.**

VictorReinz.com/AGB

**VictorReinz.com**

**reinz.info@dana.com**

**Technical Hotline +49 (0)731 7046-9 99**

**REINZ-Dichtungs-GmbH**

Reinzstrasse 3-7  
89233 Neu-Ulm  
Germany  
+49 (0)731 7046-0

***VICTOR REINZ***<sup>®</sup>

---

